



Huba Control

Pressure transmitter for refrigeration applications Type 560

Huba Control is expanding its product family of pressure transmitters with a new product series for OEM customers in the refrigeration sector.

The 560 features the well known Huba Control stainless steel sensor technology that has proven itself millions of times over. Thanks to the hermetically welded construction, the 560 is suitable for known refrigerants such as ammonia and CO₂ as well as other refrigerants from safety classes A2L and A3. This gives you great flexibility within your applications.

With a wide range of variants, such as the copper soldering tube, the pressure transmitter type 560 can be optimally integrated into your application.

Pressure range

-1 ... 7 bar 0 ... 10 – 150 bar

- + Compact and robust design
- + 100% leakage control with helium during production
- + Due to the hermetically welded construction, no elastomer seals are required
- + Two colour versions of connectors for easy identification of pressure ranges within an application
- + Rated according to DIN EN 60335-2-40
- + Copper soldering tube for optimal integration into your copper pipe system

٦r	ese	sur	e r	an	ge	

	Relative	-1 7 bar / 0 10 − 150 bar
--	----------	---------------------------

Operating conditions

Medium		Refrigerants	
	Medium ratiom. 10	. 90% -40 +125 °C	
Temperature	Medium 4 20 mA	-40 +120 °C	(other temperatures on request)
·	Ambient	-40 +85 °C	
	Storage	-40 +100 °C	
Tolerable overload	· ·	3 x fs 1)	
Rupture pressure		6 x fs 2)	

Materials

Cover		Stainless steel 1.4301 / 1.4404
Plug accommodation		Polyacrylamide 50% GF UL94 V0
Materials in contact with medium ³⁾	Thread	Stainless steel 1.4301 / AISI 304
	Soldering connection	CuDHP / CW024A
	Sensor	Stainless steel 1 4016

Electrical overview

	Output	Power supply	Load	<u>Current consumption</u>						
2 wire	4 20 mA	8 32 VDC	< supply voltage - 8 V 0.02 A	< 23 mA						
3 wire	ratiom. 10 90%	2.97 5.5 VDC	>10 kOhm / < 10 nF	< 7 mA						
Polarity reversal protection	Short circuit proof and pr	Short circuit proof and protected against polarity reversal. Each connection is protected against crossover up to max. supply voltage.								
Insulation voltage	500 VDC									

Dynamic response

Response time	ratiom. 10 90%	< 5 ms (typ. 2 ms)
	4 20 mA	< 5 ms (typ. 2 ms)

Electrical connection		Protection standard	Protection class
Metri Pack 150 P2S Series 4)	(two coloured design, black or grey)	IP 67 ⁵⁾	III
Swift connector	(two coloured design, black or grey)	IP 67 ⁵⁾	III

Pressure connection

1 1 COOUT C CONTICCCION			
Inside thread	⁷ / ₁₆ - 20 UNF	sealing cone 45° and Schrader	
Outside thread	⁷ / ₁₆ - 20 UNF	sealing cone 45°	
	1/4 -18 NPT	sealing in thread	
	G 1/4	sealed at back DIN EN ISO 1179-2 with profile seal ring in FKM	
	G 1/4	sealed at back DIN EN ISO 1179-2 with profile seal ring in EDPM	
Soldering connection 6)	Tube Ø 6 mm	L = 35 mm	

Installation arrangement

Unrestricted

Tests / Admissions

1 00 00 / 7 10 11 11 00 10 110	
UL	ANSI/UL 61010-1 acc. E325110
Electromagnetic compatibility	CE-Conform acc. EN 61326-2-3:2013

Weight

~ 90 g

Packaging (recycleable)
Multiple packaging in cardboard (25 pcs.)
min. order quantity 100 pcs.

Parameter	Unit	typic.	max.
Characteristic line acc. IEC 61298-2 ⁷⁾	% FS	0.5	1
Resolution	% FS	0.1	
Thermal characteristic -20+85°C	% FS	1	1.5
Thermal characteristic -40+125°C	% FS	1.5	2
Long term stability acc. IEC 61298-2	% FS	0.2	

Test conditions: 25°C, 45% rF

¹) Soldering tube with pressure range ≥90 bar: max. 200 bar with media contact. ⁴⁾ Delivery without female connector.

²⁾ Soldering tube with pressure range ≥90 bar: max. 600 bar

³⁾ The application medium must be suitable for the materials of the pressure transmitter 1) The specified protection class only applies when connected with a matching plug of the corresponding protection class; IP test not part of UL61010-1

 $^{^{\}mbox{\tiny 6}}$ Soldering tube with end stop, without end stop on request. $^{7)}$ incl. zero point, full scale, linearity, hysteresis and repeatability

					1	2	3	4	5	6	7	8	9	10	11
Order code selection table in bar 560.						Χ	Х	Х	Χ	Х	Χ	Χ	Χ	Χ	Χ
	-1 7 bar				9	1	1		0,5						
	0 10 bar				9	1	2		0,5						
	0 16 bar				9	1	3		0,5						\Box
	0 18 bar				9	1	4		0,5						
Pressure range (relative)	0 30 bar				9	1	5								
r researe range (retaure)	0 45 bar				9	1	6								
	0 50 bar				9	1	7								
	0 60 bar				9	1	8								
	0 90 bar				9	1	9								
	0 150 bar				9	1	Α								
Output / power supply	Ratiom. 10 90%		2.97 5.5 VDC	3 wire				7						ш	
Output / power supply	Analog 4 20 mA		8 32 VDC	2 wire				3						ш	
	Swift connector (black)		2L: IN=1 / OUT=3	3L: IN=1 / OUT=2 / GND=3					0					Ш	
Electrical connection	Swift connector (grey)		2L: IN=1 / OUT=3	3L: IN=1 / OUT=2 / GND=3					Α					ш	
Etectificat confidence	Metri Pack 150 P2S (blac		2L: IN=B / OUT=A	3L: IN=B / OUT=C / GND=A					5					ш	
	Metri Pack 150 P2S (grey		2L: IN=B / OUT=A	3L: IN=B / OUT=C / GND=A					В					ш	
	Inside thread	⁷ / ₁₆ -20 UNF with	Schrader							K	0	0	0	0	
		⁷ / ₁₆ -20 UNF								2	0	0	0	0	\perp
Pressure connection	Outside thread	½ -18 NPT								Υ	0	0	0	0	
	Outside tilledd		ck DIN EN ISO 1179-2 with pro							4	Α	0	0	0	
			ck DIN EN ISO 1179-2 with pro							4	В	0	0	0	
	Soldering connection	Tube Ø 6mm		L = 35 mm						W	0	0	0	0	
Pressure range variation (optional)	Indicate W and state rar	Indicate W and state range on order (e.g. W -1 + 3 bar/Out 10 90%)													W

					1	2	3	4	5	6	7	8	9	10	11
Order code selection table in psi 560.					Χ	Χ	Χ	Χ	Χ	Χ	Χ	Χ	Χ	Χ	Χ
	-15 100 psi				9	Α	1		0,5						
	0 145 psi				9	Α	2		0,5						
	0 230 psi				9	Α	3		0,5						
	0 260 psi				9	Α	4		0,5						
Pressure range (relative)	0 435 psi				9	Α	5								
r ressure runge (returive)	0 650 psi				9	Α	6								
	0 725 psi				9	Α	7								
	0 870 psi				9	Α	8								
	0 1300 psi				9	Α	9								
	0 2170 psi				9	Α	Α								
Output / nower supply	Ratiom. 10 90%		2.97 5.5 VDC	3 wire				7							
Output / power supply	Analog 4 20 mA		8 32 VDC	2 wire				3							
	Swift connector (black)		2L: IN=1 / OUT=3	3L: IN=1 / OUT=2 / GND=3					0						
Electrical connection	Swift connector (grey)		2L: IN=1 / OUT=3	3L: IN=1 / OUT=2 / GND=3					Α						
	Metri Pack 150 P2S (blac	(k) 1)	2L: IN=B / OUT=A	3L: IN=B / OUT=C / GND=A					5						
	Metri Pack 150 P2S (grey	/) ¹⁾	2L: IN=B / OUT=A	3L: IN=B / OUT=C / GND=A					В						
	Inside thread	7/16-20 UNF with Sch	rader							Κ	0	0	0	0	
		⁷ / ₁₆ -20 UNF								2	0	0	0	0	
Pressure connection	Outside thread	½ -18 NPT								Υ	0	0	0	0	
Pressure connection	Outside tillead	G ¼ sealed at back D	IN EN ISO 1179-2 with prof	ile seal ring in FKM						4	Α	0	0	0	
		G ¼ sealed at back D	IN EN ISO 1179-2 with prof	ile seal ring in EPDM						4	В	0	0	0	
	Soldering connection	Tube Ø 6mm		L = 35 mm						W	0	0	0	0	
Pressure range variation (optional)	Indicate W and state rar	ge on order (e.g. W -1	+ 3 bar/Out 10 90%)												W


Variations

Deviation factor	0.33 1.33 (must not be undercut or exceeded)
Accuracy	Standard accuracy / variation factor (for variation factor < 1)
Lowest starting point (relative)	-1 bar


Ex. 1: Sensor with a measuring range of 0...10 bar is to be adjusted to 0...4 bar. Deviation factor = $\frac{4 \text{ bar}}{10 \text{ bar}}$ = 0.4 \rightarrow ok, because the deviation factor is within 0.33 ... 1.33.


Ex. 2: Sensor with a measuring range of 0...10 bar is to be calibrated to 0...2 bar. Deviation factor = $\frac{2 \text{ bar}}{10 \text{ bar}}$ = 0.2 \rightarrow cannot be synchronized, as the deviation factor is not within 0.33 ... 1.33.

1) Delivery without female connector

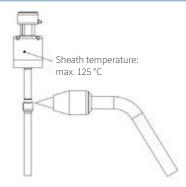


Surface temperature of the sensor in the event of a fault as a function of the supply power. Measured according to EN60335-2-40

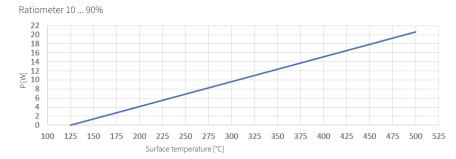

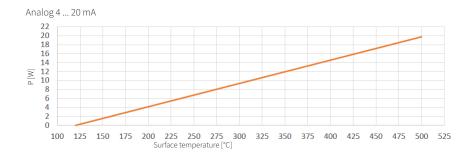

Swift connector


2-Leiter / 2 wire / 2 techn. fils

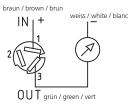


1 (IN) 3 (OUT)

4/6

3-Leiter / 3 wire / 3 techn. fils

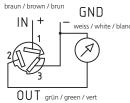


1 (IN) 2 (OUT) 3 (GND)

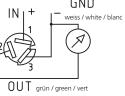


Metri Pack Series 150


3-Leiter / 3 wire / 3 techn. fils 2-Leiter / 2 wire / 2 techn. fils

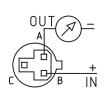



B (IN) A (OUT)

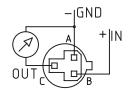



B (IN) C (OUT) A (GND)

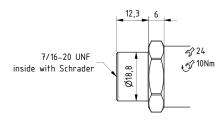


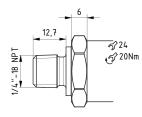


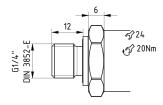

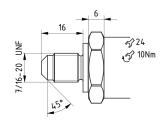

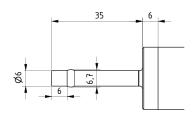

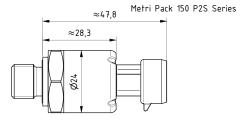

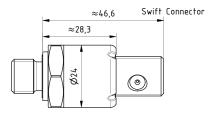

Huba Control AG

Headquarters Schweiz Industriestrasse 17 CH-5436 Würenlos Tel. +41 56 436 82 00 info.ch@hubacontrol.com

Area support finder

Contact for product and application advice in your area:



hubacontrol.com/en/ countries-markets

